



## VEHICLE INSPECTION REPORT

<b>Customer</b> Sample only	<b>Location</b> Mulgrave	
<b>Booking Code</b> 2708795	<b>Inspector</b> Willem	<b>Date</b> 12-11-2010
<b>Inspection Type</b> Platinum	<b>Make</b> Holden	<b>Model</b> Captiva

### Vehicle Details

<b>Badged</b> CAPTIVA	<b>Registration Number</b> AX072B
<b>State Registered</b> Vic	<b>Body Colour</b> Grey
<b>Aust Compliance</b> 8/13	<b>Build Date</b> 8/13
<b>Odometer KM</b> 84127	<b>VIN Number</b> KL3CA26UJXYZ060030
<b>Engine Number</b> LE91480060	<b>Number of Cylinders</b> 4
<b>Number of Doors</b> 4	<b>Engine Type</b> PETROL
<b>Transmission Type</b> AUTOMATIC	

ITEMS ON THIS REPORT ARE ONLY TESTED IF APPLICABLE TO THIS PARTICULAR VEHICLE.  
THE ONUS OF THE VEHICLE'S AUTHENTICITY / VERIFICATION IS SOLELY THE RESPONSIBILITY OF THE PURCHASER.  
VIN AND ENGINE NUMBERS CAN BE CHECKED FOR TAMPERING, HOWEVER, NOT GUARANTEED. ENGINE NUMBER WILL ONLY BE RECORDED FROM THE ENGINE IF CLEARLY VISIBLE, OTHERWISE COPIED FROM REGISTRATION RECORDS IF AVAILABLE.  
We only inspect the components on the report checklist, further inspection may be recommended for any concern found.  
Please refer to the last page for further advice and information on what we do and don't check.

PLEASE NOTE: THIS REPORT IS NOT A ROADWORTHY OR SAFETY CERTIFICATE OF ANY KIND, WHICH MAY BE NEEDED IN VARIOUS STATES FOR REGISTRATION PURPOSES.

STATEROADS ADVISES ALL PURCHASERS to check with the relevant authorities Australia wide for any type of Write - Off history PRIOR TO PURCHASE

StateRoads gives no guarantees on previous repair history nor is the vehicle's Body alignment measured or components removed. A final visual inspection of a vehicle at the point of sale is the responsibility of the purchaser. StateRoads can not be held liable for any dents/ damage or condition change after the initial inspection. Please ensure to view / print this report in colour. If unable to do so, please contact us for assistance.

This inspection does not check or guarantee previous work or quality of workmanship carried out on the vehicle. For example, whether the manufacturer's specified oils, fluids and coolants have been used. We do not decode tyres fitted, age nor load ratings.

Inspection and assessment has been by visual and noise appreciation only and no adjustment have been made nor components dismantled to confirm diagnosis. Whilst every care is taken StateRoads Vehicle Inspection cannot report about a defect if we cannot see or it does not appear during the inspection. It is in the opinion of our experienced inspectors that the items are in the condition indicated on this report.

Should there be a concern with the accuracy of this report contact StateRoads prior to any work being carried out.

THIS REPORT IS NOT A WARRANTY OR GUARANTEE, IT IS ONLY INTENDED FOR THE PERSON(S) NAMED ABOVE AND IS NOT TO BE RELIED UPON BY ANY OTHER PERSON(S) OR PURPOSE.

WHAT WE DON'T CHECK -Fuel and oil consumption, timing belts, alarm/ security system, trip meters / computers, navigation equipment / GPS, operation of TV, cassette or compact disc player, automatic switching of wipers and lights, body work water leaks.

We don't check any Filters including diesel particulate filters and catalytic converters.

## Engine and Engine Bay

**Battery** Discharged  
**Battery Terminals**  
**Alternator** Tested  
**Radiator**  
**Radiator Reservoir**  
**Heater Hoses & Tap** General ageing  
**A/C Operation** Satisfactory  
**A/C Cooling Fan**  
**A/C Compressor**  
**Cooling / Fan Blade**  
**Drive Belts** Satisfactory  
**Hydraulic Hoses**  
**Fuel Pump Operation**  
**F.I. Assy / Carb**  
**Welsh Plugs**  
**Starter Motor**  
**Brake Master Cyl.** Needs flushing  
**Cylinder Cap / Seal**  
**Intake Manifold**  
**Turbo Charger** Not Applicable  
**Engine Cover**  
**Washer Bottle**  
**LPG System** Not Applicable  
**Eng. Stabiliser Mounts**

**Bat. Tray and Holder**  
**Wiring Secured**  
**Radiator Pressure Test** Tested To: 14 PSI  
**Radiator Hoses** General ageing  
**Coolant Condition**  
**Heater Hoses to Core** General ageing  
**A/C Condensor**  
**A/C Pipes and Hoses**  
**Thermostat Housing**  
**Water Pump Operation**  
**Power Assist Steering**  
**Fluid Condition** Needs flushing  
**Fuel Line / Hoses**  
**Air Filter Casing**  
**Distributor**  
**Power Booster** Vacuum leak  
**Clutch Master / Cable** Not Applicable  
**Emission Control Visual**  
**Exhaust Manifold**  
**Turbo-oil Leaks** Not Applicable  
**Fuse Box & Cover**  
**Cables**  
**Oil Cap Deposits** Good

## Engine Condition

**Compression Result (Optional)** Balance tested  
**Hot Engine Runs / Sound** Satisfactory  
**Engine Exhaust Smoke** Slight smoke  
**Engine Oil Level** Satisfactory  
**Engine Oil Condition**  
**Engine Balance Tested** Yes

**Cold Engine Runs / Sound** Ho  
**CO2 Head Leakage Test** Pass  
**Vehicle Diagnostic Scan** Not included  
**Engine Bay Oil Leaks**  
**Automatic Transmission Oil Condition** Not visible  
**Cold Tested** No

Note: Timing Belts and chains are not physically checked. Please refer to manufacturer's specifications for replacement intervals and service records.

We do not inspect the engine internals, which include fuel injectors, egr valves nor how much soot or carbon build up there is which can be a common problem on all diesel engines, especially in the higher km range and can impact on the life expectancy of the engine. Thorough and regular Service history, fuel additives and how the vehicle has been driven can have an impact on carbon or soot build up.

### Added Notes

No coolant or co2 leakage was detected during cooling system testing. No Engine bay oil leakage found at time of engine bay inspection. Engine runs and sounds good also showing no internal running faults.

ENGINE WAS WARM OR HOT UPON ARRIVAL AND THEREFORE COULD NOT DO COLD START TEST. THIS IS STRONGLY RECOMMENDED PRIOR TO PURCHASE AS THIS MAY DETECT EARLY SIGNS OF INJECTOR AND ENGINE PROBLEMS.

## Under Body Drive Line

**Clutch Slave / Fork** Not Applicable  
**G/Box Linkages**  
**Driveshafts**  
**Trans Fluid Leaks** Satisfactory  
**Front CV Boots**  
**Front Differential**  
**Rear Differential**  
**Transfer Case Leaks**  
**Underside Oil Leaks** Satisfactory

**Speedo Drive**  
**G/Box Mount**  
**Driveshaft Uni. Joints**  
**Trans Wires / Lines**  
**Rear CV Boots**  
**Front Diff Oil Leaks** Not applicable  
**Rear Diff Oil Leaks**  
**Engine / Trans Mounts** Satisfactory

Note: Oil leaks cannot be detected if they are cleaned / degreased before inspection and not evident. Drum Brake assembly cannot be checked as Wheels are not removed.

### Added Notes

No oil leaks visible at underbody driveline-showing clean condition

## Steering, Brakes and Suspension

**Exhaust / Catalytic**  
**LPG Tank Guard** Not Applicable

### Mufflers

#### LEFT FRONT

**Wheel**  
**Steering Arms / Tie Rod**  
**Strut / Shock**  
**Hub Assembly**  
**Control Arm(s)** Showing some wear  
**Brake Pads** 50%  
**Leaf / Coil Springs**

**Tyre** 60%  
**Steer / Suspension Bushes** Showing some wear  
**Ball Joint**  
**Wheel Bearings**  
**Brake Disc Rotor**  
**Brake Caliper & Hose**  
**Sway Bar Mount**

#### LEFT REAR

**Wheel**  
**Suspension Bushes** Showing signs of wear  
**Strut / Shock**  
**Brake Pads** 80%  
**Brake Caliper & Hose**

**Tyre** 60%  
**Leaf / Control Arm(s)**  
**Brake Disc Rotor**  
**Brake Drag**  
**Wheel Bearings**

#### RIGHT FRONT

**Wheel**  
**Steering Knuckle**  
**Steering Arms / Tie Rods**  
**Strut / Shock**  
**Hub Assembly**  
**Control Arm(s)**  
**Brake Pads** 50%  
**Leaf / Coil Springs**

**Tyre** 60%  
**Steering Rack / Box**  
**Steer / Suspension Bushes** Showing some wear  
**Ball Joint**  
**Wheel Bearings**  
**Brake Disc Rotor**  
**Brake Caliper & Hose**

#### RIGHT REAR

**Wheel**  
**Leaf / Control Arm(s)**  
**Brake Disc Rotor**  
**Brake Drag**  
**Wheel Bearings**

**Tyre** 60%  
**Strut / Shock**  
**Brake Pads** 80%  
**Brake Caliper & Hose**

Note: Brake Disc Rotor Thickness / wear is not measured. Please note this may be a roadworthy requirement in some states. BRAKE PAD % IF SHOWN ARE REMAINING PORTION, PLEASE NOTE THAT SOME WORKSHOPS WILL SUGGEST TO REPLACE THE BRAKE PADS AS EARLY AS 40% - 50% REMAINING

### Added Notes

Brake disc rotors have minor wear lips, but may still be serviceable

# Chassis, Body and Panels

## LEFT FRONT

**Windscreen** [Minor chips check RWC](#)  
**Park / Headlight Glass**  
**Door Hinges**  
**Door Lock and Key**

**Bonnet Stay / Struts**  
**Repeater / Indicator Lens**  
**Door Rubber Seals** [Satisfactory](#)

## LEFT REAR

**Glass / Trim**  
**Boot Tailgate Support**  
**Spare Wheel or Kit**  
**Moulds / Strips** [Faded](#)

**Weather Seals / Rubber** [Satisfactory](#)  
**Tail Light Lens**  
**Jack / Tools**

## RIGHT FRONT

**Bumper / Bull Bar assy**  
**Repeater / Indicator Lens**  
**Door Rubber Seals**

**Park / Headlight Glass**  
**Door Hinges**  
**Door Lock and Key**

## RIGHT REAR

**Glass / Trim**  
**Sunroof** [Satisfactory](#)  
**Bumper / Beaver Panel**

**Weather Seals / Rubber** [Satisfactory](#)  
**Fuel Cap / Door**  
**Tail Light Lens** [Satisfactory](#)


Body Panels have been tested and paint/coating thickness has been measured with a digital meter to detect any repairs.

### Added Notes

Vehicle shows no signs of body repairs - paint thickness is consistent with factory original thickness

No major damage visible at body - shell showing minor dents and scratches and cosmetic attention may be needed to improve overall appearance

Minor chips/marks to windscreen, visibility ok, although replacement at discretion of RWC inspector

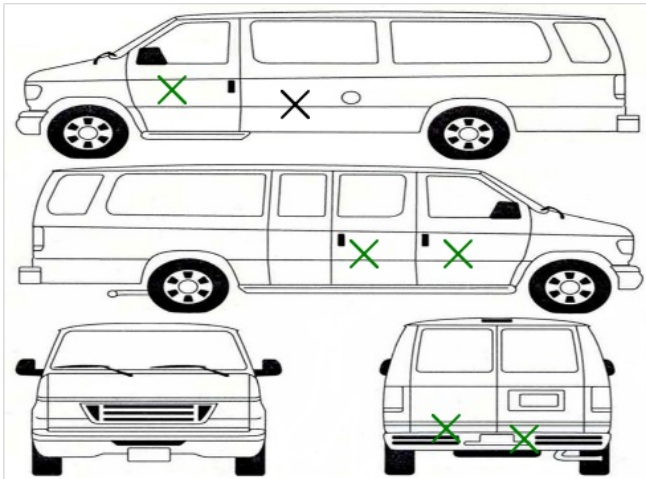

**Cosmetic Panel / paint = Green**

**Minor Scratches / Dents = Grey**

**Damaged / Dented = Black**

**Previous Body Repairs = Orange**

**Rust = Red**

Note: Please be advised:

Stateroads will note larger type damage and previous accident repairs to all vehicles when conducting a full comprehensive inspection. However smaller shopping size dents, scratches or hail damage will not be noted or guaranteed due to our mobile service encountering dirty unwashed vehicles and lighting conditions on site. It is the purchaser's responsibly to re - check the inspected vehicle personally before settlement.

## Interior

**Floor Covering / Carpet**  
**Glove Box**  
**Door Trims**  
**Sun Visors**  
**Interior Mirror**  
**Comb. Switch**  
**Front and Rear Wiper** [Blades need replacing](#)  
**A/C Operation** [Satisfactory](#)  
**Fan Speed Control** [Satisfactory](#)  
**Recycle Control**  
**Steering Wheel Grip**  
**Pedal Rubbers**  
**Console**  
**Windows Operation** [Satisfactory](#)  
**Front Seat Belts**  
**Front Seat and Operation**  
**Rear Cover / Parcel Tray** [Not Applicable](#)  
**Warning Lights**  
**Oil Pressure Light**

NAVIGATION, CD and CASSETTE PLAYERS ARE NOT TESTED

Some radios require a security code for operation. Please ensure to obtain that code.

### Added Notes

[Interior trim and carpet is in good and clean condition](#)

**Dashboard**  
**Air Vents**  
**Roof Lining**  
**Interior Light**  
**Exterior Mirror**  
**Hazard Switch**  
**Washers**  
**Heater Operation** [Satisfactory](#)  
**Air Flow Control** [Satisfactory](#)  
**Park Brake Operation**  
**Horn**  
**Radio** [Satisfactory](#)  
**Sun Roof Operation**  
**Key / Remote** [2 remotes provided](#)  
**Rear Seat Belts**  
**Rear Seat Operation**  
**Fuel / Temp Gauges**  
**A.B.S. and S.R.S Lights** [Satisfactory](#)

## Road Test Report

**Inhibitor Switch**  
**Clutch Ride** [Not Applicable](#)  
**Brakes (ABS)**  
**Steering**  
**Steering Vibrations**  
**Gear Box Synchronesh** [Not Applicable](#)  
**Rev. Under Load**  
**Speedo**  
**Trip Meter**  
**Turbo Charger** [Not Applicable](#)  
**Driveshaft Vibrations**  
**Engine Performance** [Satisfactory](#)  
**Trans Flare / Whine**  
**Speed Limit When Tested** [60k](#)

\* 4WD Vehicles are not tested off road

\* Vehicles can only be tested within the local speed limits

### Added Notes

[This car performs reasonable for age and km showing mostly consistent wear and audible wear for age](#)

**Clutch Operation** [Not Applicable](#)  
**Brake Sink / Travel**  
**Brake Shudder** [Satisfactory](#)  
**Road Handling**  
**Steering Wheel Align**  
**4x4 High and Low** [Not Applicable](#)  
**Gas Operation** [Not Applicable](#)  
**Odometer**  
**Cruise Control** [Satisfactory](#)  
**Front C.V. Joints**  
**Ride and Comfort**  
**Engine Smoke**  
**Differential Whine**

## Inspection Report Summary

<b>Body Rating</b> 70%	-
<b>Mechanical Rating</b> 70%	-
<b>Interior Rating</b> 70%	-

### General Overview

Please view photos as they form part of this report.

Service books sighted and show service history.

Vehicle requires servicing / repairs as mentioned in report.

For a more accurate report would suggest a computer diagnostic scan to determine any hidden problems in the vehicles electronic system. This vehicle could not be cold tested as noted in report

Battery testes fair, may require early replacement.

\*This vehicle has been assessed taking into consideration the kms displayed, the vehicle age and the condition of the vehicle as inspected

All vehicles are inspected as presented. In many cases vehicles are dirty / unwashed etc.

Please ensure to read this report in full including any added notes which may point out any repairs, servicing, faults or problems.

Further explanation of the report is made by speaking directly with your inspector, whom will phone you after the inspection or by the end of that working day. If you were not available to take the call, please phone the inspector as a verbal explanation of the inspection report is important.

WE STRONGLY SUGGEST: A final visual inspection of the vehicle at the time of settlement, and is the responsibility of the purchaser.

StateRoads can not be held liable for any dents, Damage or Mechanical condition change or alterations after the initial inspection. Transported vehicles are commonly found to suffer damage in transit and in most cases no responsibility is taken by the transport company.

BEWARE: Always check for a clear title before purchasing a vehicle especially on private sales.

HISTORY AND P.P.S.R. ENCUMBRANCE CHECKS ARE AVAILABLE DIRECTLY FROM OUR STATEROADS OFFICE. PLEASE CONTACT THE RELEVANT STATE WHERE INSPECTED (charges may apply).



[admin@stateroads.com.au](mailto:admin@stateroads.com.au)

**NSW 1300 737 450 | VIC 03 9850 8000 | QLD 07 3367 8000 | Perth 1300 737 450**